


# Installation, Operation, and Maintenance Manual

## Heating Cable Repair Kit

**⚠ WARNING**

 **Read this Manual BEFORE using this equipment.**  
**Failure to read and follow all safety and use information can result in death, serious personal injury, property damage, or damage to the equipment.**  
**Keep this Manual for future reference.**

**THINK SAFETY FIRST**

**Warranty Disclaimer:** This repair kit and these installation guidelines are provided to assist in repairing a heating cable damaged at the job site. There is no warranty, in anyway to the repair or proper function of the product following the repair. Only a qualified electrician should make repairs to the heating cables. It is highly recommended that an experienced floor covering installer remove the floor covering over the damage.

It is the responsibility of the installing party or homeowner to qualify electricians, floor covering installers, to perform diagnostics, floor covering removal, or cable repair. It is also the responsibility of the installing party or homeowner to contact a qualified person to follow these guidelines.

DO NOT USE this repair kit to splice different cables together. The kit is only for making a repair within a cable.

DO NOT USE this repair kit to repair a cable within a shower area or a cable that extends into a shower area.

## Materials and Tools Needed

### Heating Cable Repair Kit:

#### 2 Ground solder tubes



#### 4 Solder tubes




#### 2 jumper wires

#### 1 Ground jumper wire

This heating cable repair kit contains components for making a repair at one location. Certain components may not be used depending on the method of repair selected.

### Additional tools needed:

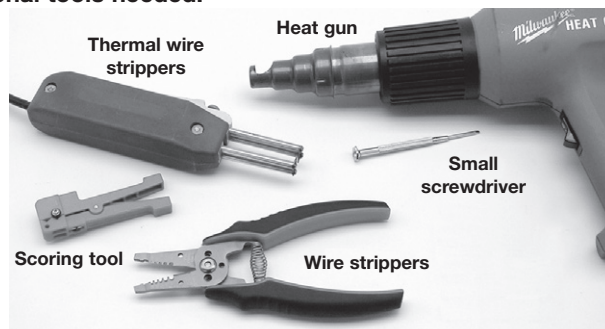

#### Heat gun

- Must be able to heat to about 1000°F.
- Milwaukee Model 8975, shown with reduction nozzle.

#### Thermal wire strippers

- For stripping the heating wires.
- Omega Model TW-1.

#### Scoring tool

- For cable with a hard plastic (XLPE) outside jacket.
- Ideal Model 45-403 with blade Part K-6502.

#### Wire strippers

- For cutting and stripping 16-AWG wire.
- GB Model GESP-55.

#### Small screwdriver

- To help separate heating wire from braid.
- Paper clip or similar pointed tool may also be used.

#### Digital multimeter

- Must measure up to 20k ohms (20,000 ohms).

#### Hammer and chisel

- For removal of tile and mortar if needed, and for creating a “valley” in which to lay the splice.

#### Hot glue gun with standard stick adhesive

- For adhering splice into the “valley” chiseled into floor.

#### Scissors

**Special Note on Alternative Tool Options -** When thermal strippers are not available, the heated tip of a soldering pencil is the best alternative tool for stripping the heating elements, and the “TPU” jacket on some floor warming cables.

If your heat gun does not have a factory reducer nozzle you can make one from an empty can, or aluminum foil can be fashioned to work with a piece of wire or a hose clamp to hold it on the end of the heat gun. The nozzle opening should be about ½” wide.

## Part 1. Getting Started

**Step 1.1.** Make sure the power is OFF!

**Step 1.2.** Two repair methods are shown in these guidelines. Choose the method that is best for the installation.

**Direct splice:** This method is used when the damaged cable has enough “play” to be cut and overlapped by about 3/4 of an inch. This also gives the best possible heating uniformity over the splice versus using the jumper splice, and has fewer soldered connections.

**Jumper splice:** This method is used when the damaged cable does not have enough “play” to be cut and overlapped. This also results in a splice section that will have very little heating directly over the splice.


**Step 1.3.** Depending on the product used, the heating cable is constructed in one of the two following ways:

**Jacketed heating cable:** This cable is comprised of two insulated heating wires, covered by either a metal braid or a foil tape with ground wire, which in turn is covered by an outer covering. Each heating wire consists of an element that must be kept intact and undamaged.

#### Jacketed, braided heating cable




#### Jacketed, foil & ground cable

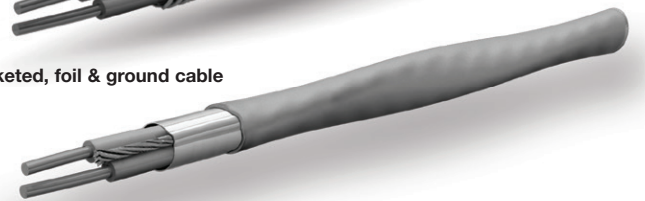

**Non-jacketed heating cable:** This cable is comprised of two insulated heating wires covered by a stainless steel braid. Each wire consists of at least one heating element that must be kept intact and undamaged.

#### Braided metal grounding jacket

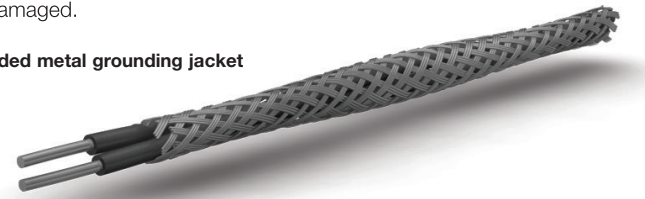

## Part 2. Tile and Mortar Removal




**Step 2.1.** If not done so already, carefully remove the tile/stone/marble floor covering over the damaged cable area. Removal of the grout around the affected tile(s) must be done with a blunt instrument such as a hand-held grout-removal tool. **DO NOT USE A KNIFE!** Gently break out the tile with a small hammer, removing the fragments as the tile is broken up.



**Step 2.2.** Remove enough mortar and tile to expose about **4" to 5"** of **free wire on both sides of the damaged portion.** Part of the wire may be visible so that the mortar can be removed carefully around the damaged wire using the hammer and/or chisel. Mesh can be cut with scissors in order to free the wire.


## Part 3. Installing a Direct Splice

To install a jumper splice (please see Step 1.2), skip to Step 4.1.

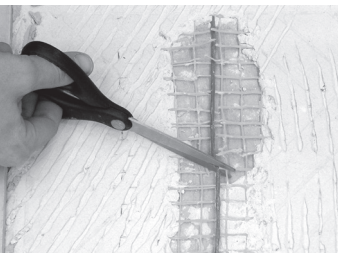


**Step 3.1.** Cut out the damaged wire location, creating two ends or leads. **If the cable being repaired is not the jacketed heating cable, skip to Step 3.6.**

**Step 3.2.** For a heating cable with an outer jacket: Strip off approximately 2.5 inches of the outer jacket. **DO NOT USE standard wire strippers!** The out of round character of the cable makes it very difficult to strip with a common wire stripper tool, using one could damage the cable. There are two types of jacket compounds, "XLPE" and "TPU" (TPU see Step 3.3.b).

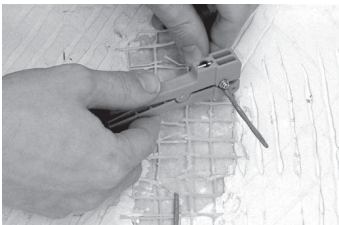


Some of our products have an "XLPE" jacket that is a somewhat hard material that can be lightly "scored" with a scoring tool or sharp blade. Use the scoring tool to carefully score the jacket about 2.5" from the end of each lead. Do this by placing the cable lead into the V-notch of the tool and rotating the tool only one or two revolutions around the cable. Do not place any additional pressure on the tool head to cut deeper. Let the tool apply its own spring-loaded pressure.

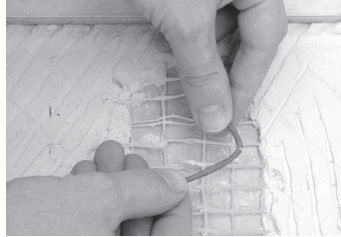

**Step 3.3.** Gently bend the cable at the score to break through the jacket all the way around the cable, then pull off the slug


**Step 3.3.b.** If the jacket is the softer "TPU" material, you'll find it is easier to use thermal wire strippers or the tip of a soldering pencil to melt a narrow ring around the outer jacket of the cable, then pull the slug off. The TPU jacket has a lower melt point than the insulation on the heating elements, but you must still be very careful to avoid overheating the heating elements during this step.

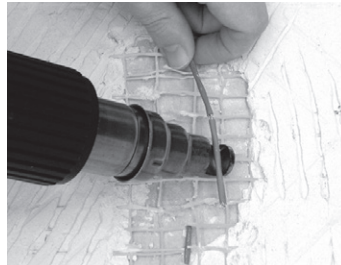

**Step 3.4.** With either type of jacket, if it doesn't easily pull off you may need to use your heat gun to gently warm the slug, which should soften and loosen it for you. Use the heat gun (set to about 500°F) and move the gun back and forth under the jacket slug for about 3 or 4 seconds, or until it can be easily removed.




**Step 3.5.** Use a glove or other protective cloth to pull off the loosened jacket slug. **Do not touch** the hot jacket slug with bare fingers. The slug will be very hot and will burn!

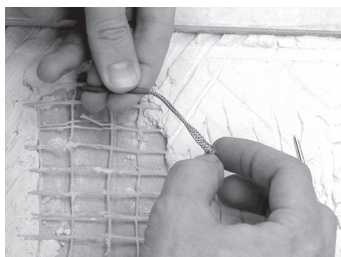


**Step 3.6.** Loosen the braid by pushing back on the braid about 1/2" and cause the ends of the heating wires to be exposed.


**Note:** Some of our heating cables do not have a braided ground shield. These cables will have a ground drain wire and a foil wrap. Simply remove the foil and proceed to Step 3.10.

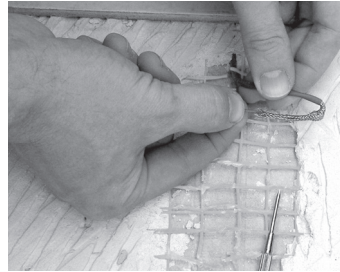


**Step 3.7.** Bend the cable back onto itself.

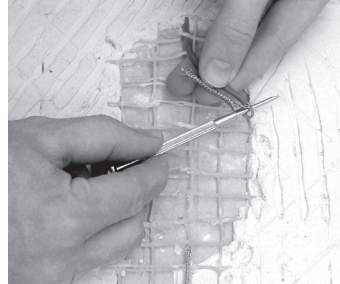


**Step 3.8.** Use the small screwdriver, paper clip, fingernail, or similar blunt instrument to pry between the braid and make an opening through which to pull the heating wires. Pull each wire through the braid.

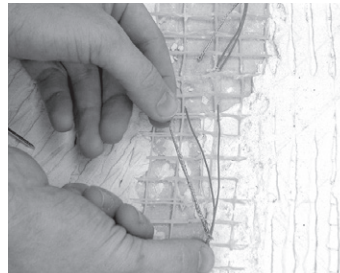


**Step 3.9.** Pull the braid straight out to make it into a pigtail.

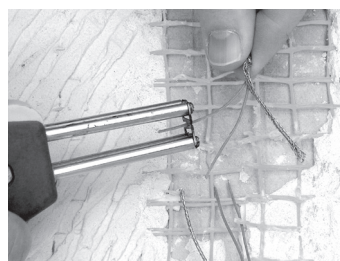


**Step 3.10.** Use the thermal wire strippers to carefully strip off exactly 1/2" of the insulation from the heating wires. Count the little heating elements to make sure none were cut off and thereby cause a hot spot or possible failure. A fiber strand may also be found among the heating elements. There is no need to separate or remove this fiber strand.

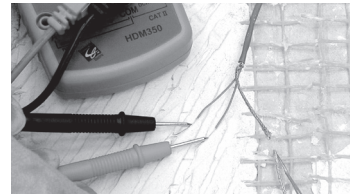


**Step 3.11.** Use the digital multi-meter and TDR at this repair location before proceeding. Check for any additional damage locations in the heating cable by "looking" in both directions. For assistance in using these instruments, consult the instructions that came with them.

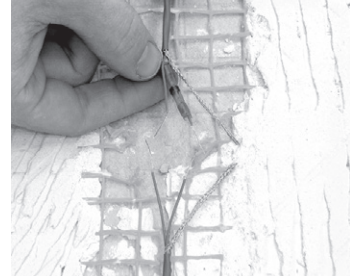

**Step 3.12.** Slide the solder tube over one of the heating wires.

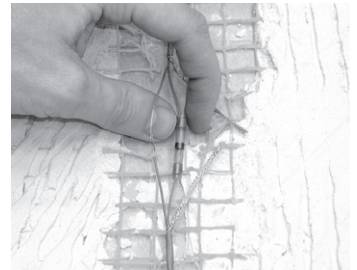


**Step 3.13.** Pull the heating wires together to overlap the heating elements of both leads. Lightly twist the elements together to better join them. Slide the solder tube over the twisted elements, centering the elements between the gray adhesive bands. If this is not done correctly, the elements may pull out and cause the splice to fail.

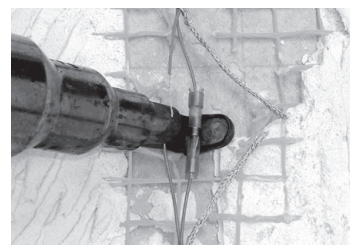


**Step 3.14.** Use the heat gun (set to HI temperature, about 1000°F) to carefully heat the solder tube. First, heat directly under the solder ring in the middle of the tube. **IMPORTANT!** When the solder completely melts and flows into the wires, continue heating for another 3 seconds. If the heat is removed too soon, an incomplete solder connection will result, causing connection failure later. When the solder is completely melted, begin moving the heat gun back and forth under the rest of the solder tube to shrink the tube and cause the adhesive bands at the ends to melt and flow onto the wire insulation. After the tube is completely shrunk and the adhesive bands are fully melted, stop heating the tube. Additional heating will not help and may cause either scorching of the tube or splice failure. Allow the solder tube to cool for about 1 minute.


### Part 3. Installing a Direct Splice (cont.)

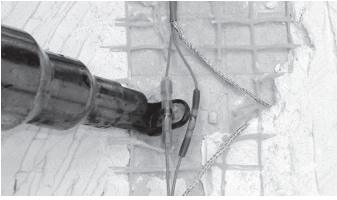


**Step 3.15.** Repeat Steps 3.12 through 3.14 for the other heating wire splice. Make sure to avoid reheating or scorching the first splice while working on the second. It may require a heat shield like a wet cotton rag or a piece of tin to protect the first splice and the insulation of the heating wires.

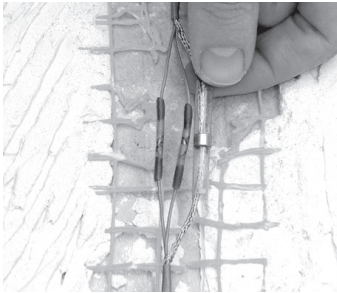

**Step 3.16.** Slide a ground solder tube onto the longer ground wire. Overlap the ground wires and twist them to help hold them together. Slide the ground solder tube over the twisted ground connection centering the connection under the ring of solder.

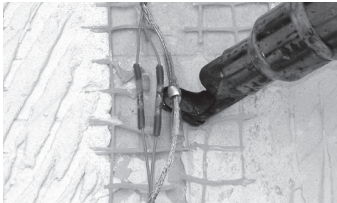


**Step 3.17.** Be sure to avoid reheating or scorching the heating wires or splices, using a heat shield again if needed. Heat the tube to shrink it completely and cause the solder to flow into the twisted ground wires completely. When it cools, the connection should be secure.

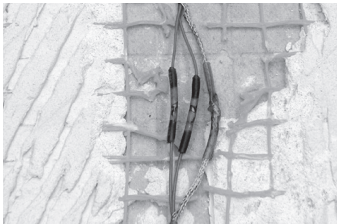

**Step 3.18.** The connection should now be complete and ready to test. Go to Step 5.1 under "Testing the Repair."


### Part 4. Installing a Jumper Splice

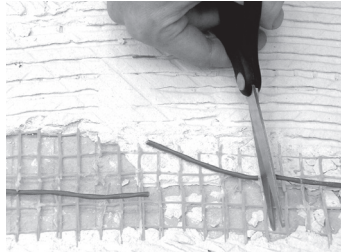


**Step 4.1.** Cut out a 2"- to 3"-long section of the heating cable around the damaged area, creating two ends or leads.

**If the cable is not a jacketed heating cable, SKIP to Step 4.6.**

**Step 4.2.** For a heating cable with an outer jacket: Strip off approximately 2.5 inches of the outer jacket. DO NOT USE standard wire strippers! The out of round character of the cable makes it very difficult to strip with a common wire stripper tool, using one could damage the cable. There are two types of jacket compounds, "XLPE" and "TPU" (TPU see Step 4.3.b).

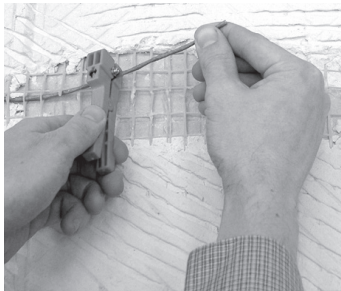

Some of our products have an "XLPE" jacket that is a somewhat hard material that can be lightly "scored" with a scoring tool or sharp blade. Use the scoring tool to carefully score the jacket about 2.5" from the end of each lead. Do this by placing the cable lead into the V-notch of the tool and rotating the tool only one or two revolutions around the cable. Do not place any additional pressure on the tool head to cut deeper. Let the tool apply its own spring-loaded pressure.

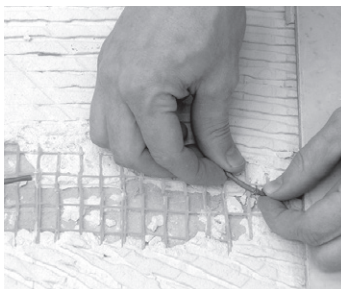

**Step 4.3.** Gently bend the cable at the score to break through the jacket all the way around the cable, then pull off the slug.


**Step 4.3.b.** If the jacket is the softer "TPU" material, you'll find it is easier to use thermal wire strippers or the tip of a soldering pencil to melt a narrow ring around the outer jacket of the cable, then pull the slug off. The TPU jacket has a lower melt point than the insulation on the heating elements, but you must still be very careful to avoid overheating the insulation on the elements during this step.




**Step 4.4.** With either type of jacket, if the jacket slug doesn't easily pull off you may need to use your heat gun to gently warm the slug, which should soften and loosen it for you. Use the heat gun (set to about 500°F) and move the gun back and forth under the jacket slug for about 3 or 4 seconds, or until it can be easily removed.




**Step 4.5.** Use a glove or other protective cloth to pull off the loosened jacket slug. Do not touch the hot jacket slug with bare fingers. The slug will be very hot and will burn!

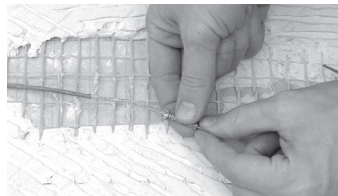


**Step 4.6.** Loosen the braid by pushing back on the braid about 1/2", causing the ends of the heating wires to be exposed.  
**Note:** Some of our heating cables do not have a braided ground shield. These cables will have a ground drain wire and a foil wrap. Simply remove the foil and proceed to Step 4.10.

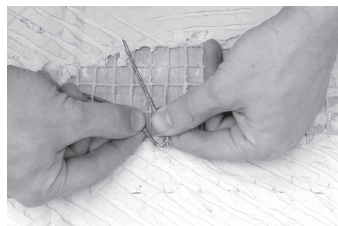

**Step 4.7.** Bend the cable back onto itself.

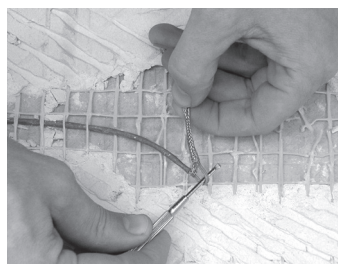

**Step 4.8.** Use the small screwdriver, paper clip, fingernail, or similar instrument to pry between the braid and make an opening through which to pull the heating wires. Pull each wire through the braid.

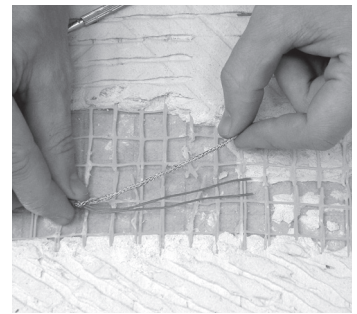


**Step 4.9.** Pull the braid straight out to make it into a pigtail.



**Step 4.10.** Use the thermal wire strippers to carefully strip off exactly 1/2" of the insulation from the heating wires. Count the little heating elements to make sure none were cut off and thereby cause a hot spot or possible failure. A fiber strand may also be found among the heating elements. There is no need to separate or remove this fiber strand.



**Step 4.11.** Use the digital multi-meter and TDR at this repair location before proceeding. Check for any additional damage locations in the heating cable by "looking" in both directions. For assistance in using these instruments, consult the instructions that came with them.

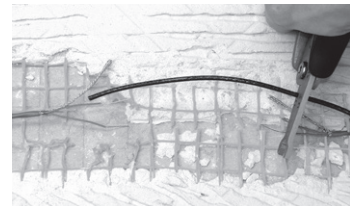


**Step 4.12.** Cut the jumper wires shorter, if necessary, so that they overlap the stripped ends of the heating wires.




**Step 4.13.** Use the 16 AWG setting on the wire strippers to strip off exactly 1/2" of the insulation from both ends of the jumper wires.

## Part 4. Installing a Jumper Splice (cont.)

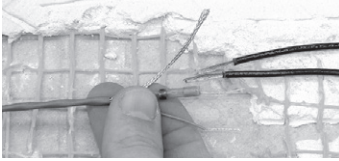

**Step 4.14.** Slide a solder tube over one of the heating wires on one lead of the heating cable, or position it on the jumper lead if that makes joining the wires easier.

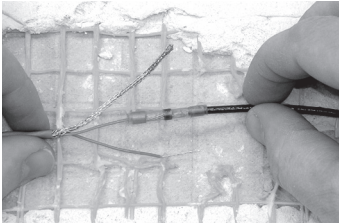


**Step 4.15.** Place the heating elements and jumper wire ends alongside each other. **Lightly** twist the elements together to better join them. Slide the solder tube over the twisted elements and over the edge of the insulation on the jumper wire. Make sure the twisted wires are fully inside the solder tube and located between the adhesive bands at the ends of the solder tube. If this is not done correctly, the elements may pull out and cause the splice to fail.




**Step 4.16.** Use the heat gun (set to HI temperature, about 1000°F) to carefully heat the solder tube. First, heat directly under the solder ring in the middle of the tube. **IMPORTANT!** When the solder **completely** melts and flows into the wires, continue heating for another 3 seconds. If the heat is removed too soon, an incomplete solder connection will result and cause connection failure later. When the solder has completely melted, begin moving the heat gun back and forth under the rest of the solder tube to shrink the tube and cause the adhesive bands at the


ends to melt and flow onto the wire insulation. After the tube is completely shrunk and the adhesive bands are fully melted, stop heating the tube. Additional heating will not help and may cause either scorching of the tube or splice failure. Allow the solder tube to cool for about 1 minute.

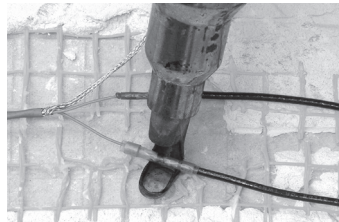


**Step 4.17.** REPEAT Steps 4.14 through 4.16 for the other heating wire. Be sure to avoid reheating or scorching the first heating wire splice, using a heat shield like a wet cotton rag or a piece of tin if needed.

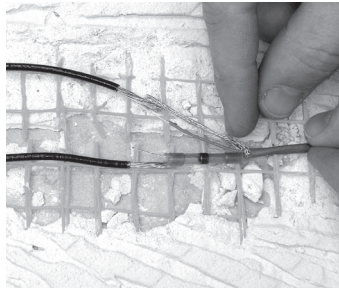


**Step 4.18.** At the other end of the jumper wires, slide a heating element solder tube over a heating wire or its jumper wire, whichever is easier for you to position the tube out of the way and allow for easy access to the ends of the wires. REPEAT Steps 4.14 through 4.17 to complete the heating element jumper wire connections.

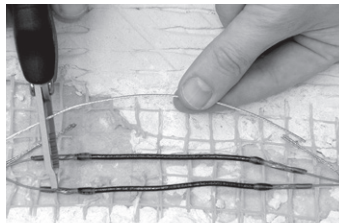


**Step 4.19.** If necessary, cut the ground jumper wire shorter so that it overlaps the ends of the ground wires by about 1/2" to 3/4".

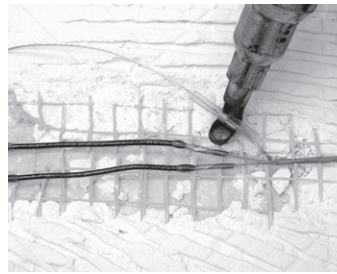

**Step 4.20.** Position a ground solder tube on the ground jumper wire. Overlap the ends of the ground wire and the ground jumper wire by about 1/2" and twist them together. Slide a ground solder tube over the twisted ends, centering the connection under the solder ring. Heat the tube to shrink it completely and cause the solder to flow into the wires completely. Be sure to avoid reheating or scorching the heating wires or splices, using a heat shield like a wet cotton rag or a piece of tin if needed. When it cools, the connection should be secure.

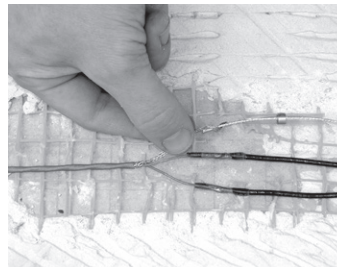

**Step 4.21.** At the other end of the ground jumper wire, slide a ground solder tube over the wire. REPEAT Step 4.20 to complete this connection. Be sure to avoid reheating or scorching the heating wires or splices, using a heat shield again if needed.

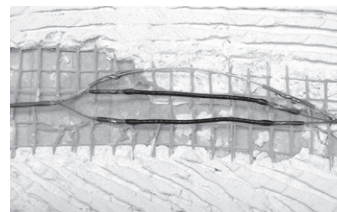

**Step 4.22.** The connection should now be complete and ready to test. Go to Step 5.1 under "Testing the Repair."

## Part 5. Testing the Repair

After completing the splice connections and letting them cool, test the repair as follows:

**Step 5.1.** Gently tug on each wire splice to make sure they are properly soldered and do not pull apart.

**Step 5.2.** Use a digital multimeter to measure the resistance of the heating cable. This measurement should fall within the resistance range specified for this heating cable. There should also be infinite resistance between the heating cable power leads and the ground wire. For this test, your multimeter should have the same display you see when not touching anything with the meter's test leads. If assistance is needed with these tests, follow the steps shown in the installation manual for this cable, or call Watts Radiant.

**Step 5.3.** Properly connect the repaired heating cable to the power source through a GFCI, such as the Watts Radiant thermostat. Operate the cable for a few days or at least for ten to fifteen 5-minute heating cycles. If the GFCI trips or the cable does not heat, the cable will need to be checked for additional damage, or else the repair may have failed.

**Step 5.4.** After the repair work is complete and you are confident the floor warming cable is in good working condition, make sure power to the system is turned off. Power should not be supplied to the floor warming cable again until the new mortar and grout have had a minimum of 2 to 3 weeks to cure out. Turning on the system before the mortar bed is fully cured can cause GFI trips when there may be nothing wrong with the floor warming cable.

## Part 6. Final Steps

Make sure the splice is protected and lays flat on the floor before installing floor coverings.

**Step 6.1.** If necessary, use a chisel to carefully carve a "valley" into the subfloor under the splice.

**Step 6.2.** Use the hot glue gun and place a bead of adhesive into the valley. Press the splice into the adhesive to recess it in the valley.

**Step 6.3.** If floor coverings are not being immediately installed, temporarily cover the splice and surrounding heating cable with a loose tile or similar hard material to protect them against damage.

**Limited Warranty:** Watts Regulator Co. (the "Company") warrants each product to be free from defects in material and workmanship under normal usage for a period of one year from the date of original shipment. In the event of such defects within the warranty period, the Company will, at its option, replace or recondition the product without charge.

**THE WARRANTY SET FORTH HEREIN IS GIVEN EXPRESSLY AND IS THE ONLY WARRANTY GIVEN BY THE COMPANY WITH RESPECT TO THE PRODUCT. THE COMPANY MAKES NO OTHER WARRANTIES, EXPRESS OR IMPLIED. THE COMPANY HEREBY SPECIFICALLY DISCLAIMS ALL OTHER WARRANTIES, EXPRESS OR IMPLIED, INCLUDING BUT NOT LIMITED TO THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE.**

The remedy described in the first paragraph of this warranty shall constitute the sole and exclusive remedy for breach of warranty, and the Company shall not be responsible for any incidental, special or consequential damages, including without limitation, lost profits or the cost of repairing or replacing other property which is damaged if this product does not work properly, other costs resulting from labor charges, delays, vandalism, negligence, fouling caused by foreign material, damage from adverse water conditions, chemical, or any other circumstances over which the Company has no control. This warranty shall be invalidated by any abuse, misuse, misapplication, improper installation or improper maintenance or alteration of the product.

Some States do not allow limitations on how long an implied warranty lasts, and some States do not allow the exclusion or limitation of incidental or consequential damages. Therefore the above limitations may not apply to you. This Limited Warranty gives you specific legal rights, and you may have other rights that vary from State to State. You should consult applicable state laws to determine your rights. **SO FAR AS IS CONSISTENT WITH APPLICABLE STATE LAW, ANY IMPLIED WARRANTIES THAT MAY NOT BE DISCLAIMED, INCLUDING THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, ARE LIMITED IN DURATION TO ONE YEAR FROM THE DATE OF ORIGINAL SHIPMENT.**

# WATTS®

SunTouch Customer Support  
888-432-8932 (toll-free phone)

Watts Radiant Customer Support  
800-276-2419 (toll-free phone)

USA: T: (800) 276-2419 • F: (417) 864-8161 • Watts.com

Canada: T: (888) 208-8927 • F: (905) 481-2316 • Watts.ca

Latin America: T: (52) 55-4122-0138 • Watts.com